

# **AM1760/1762 Secondary Standard Platinum Resistance Thermometer User's Guide**



***AccuMac***



## Table of Contents

|   |    |
|---|----|
| <i>Before you start --- Warnings &amp; Cautions</i> .....     | 3  |
| <i>1 Introduction</i> .....                                   | 4  |
| 1.1 Main Application .....                                    | 4  |
| 1.2 Main Features.....  | 4  |
| 1.3 Calibrations .....  | 4  |
| <i>2 Specifications</i> .....                                 | 5  |
| 2.1 Specifications .....                                      | 5  |
| <i>3 General Operations</i> .....                             | 6  |
| 3.1 Connecting to the readout device.....                     | 6  |
| 3.2 Drive Current .....                                       | 6  |
| 3.3 Stability of Readings.....                                | 6  |
| 3.4 Immersion Requirements .....                              | 6  |
| 3.5 Thermal EMF .....   | 7  |
| 3.6 Over heating.....   | 7  |
| <i>4 Care and Handling Guidelines</i> .....                   | 8  |
| <i>5 Troubleshooting</i> .....                                | 9  |
| 5.1 Troubleshooting .....                                     | 9  |
| 5.2 Problem Causes and Solutions.....                         | 9  |
| <i>6 Limited Warranty &amp; Limitation of Liability</i> ..... | 10 |

## ***Before you start ---- Warnings & Cautions***

- ❖ **Warnings:** Follow these guidelines to avoid personal injury:
  1. Only use this instrument in the manufacture specified temperature range.
  2. The handle of this instrument can become hot when it is used to measure high temperatures for extended periods of time.
  3. DO NOT submerge PRT handle when taking measurement.
  4. DO NOT use this instrument to measure the temperature of any hazardous live component.
  5. Follow all other safety guidelines listed in this user's guide.
  
- ❖ **Cautions:** Follow these guidelines to avoid possible damage to the instrument:
  1. Avoid mechanical shocks. DO NOT drop or slam the probe in any way. This will cause damage to the probe internally and affect its calibration and accuracy.
  2. Read Section entitled "Care and Handling Guidelines" before removing the PRT from the shipping box. Incorrect handling can damage the PRT and void the warranty.
  3. Keep the shipping container in case it is necessary to ship the PRT. Incorrect packaging of the PRT for shipment can cause irreparable damage.
  4. Calibration equipment should only be used by trained personnel.

# **1 Introduction**

## **1.1 Main Application**

AM1760/1762 Secondary Standard Platinum Resistance Thermometer (SPRT) is an interpolating instrument converting temperature to resistance. It works together with a readout device to measure temperature or change of temperature. It has wide applications for dry-wells or temperature baths.

## **1.2 Main Features**

- High accuracy:  $\pm 0.006$  °C at 0.01 °C
- Temperature range: : -200°C to 670°C
- Rtpw Drift < 19 mK after 500 hours of use

## **1.3 Calibrations**

It is recommended to calibrate this PRT annually over the full temperature range. In between annual calibrations, user can check the drift rate by comparing Rtpw against the last calibration results. Refer to specifications section for normal drift rate.

## 2 Specifications

### 2.1 Specifications

|                                   |  |
|-----------------------------------|--|
| <b>Temperature Range</b>          | -200°C to 670°C  |
| <b>Resistance at 0 °C</b>         | 1760 - Nominal 100 Ω<br>1762 – Nominal 25 Ω  |
| <b>Temperature Coefficient</b>    | 0.003925 Ω/ Ω/°C   |
| <b>Accuracy</b>                   | ±0.007°C at -196 °C<br>±0.006°C at 0.01 °C<br>±0.015°C at 420 °C<br>±0.025°C at 660 °C   |
| <b>Drift*</b>                     | ±0.004°C at 0 °C after 100 hours at 660 °C   |
| <b>Short Term Stability</b>       | ±0.002°C   |
| <b>Thermal Shock</b>              | ±0.002°C after 10 times thermal cycles from minimum to maximum temperatures  |
| <b>Self-heating</b>               | 0.0015 °C at 1 mA current  |
| <b>Response Time</b>              | 9 seconds for 63% response to step change in water moving at 3 feet per second   |
| <b>Measurement Current</b>        | 1 mA   |
| <b>Sensor Length</b>              | 42 mm  |
| <b>Sensor Location</b>            | 5 mm from tip  |
| <b>Insulation Resistance</b>      | >1000 MΩ at room temperature   |
| <b>Sheath Material</b>            | Inconel™   |
| <b>Dimension</b>                  | 1760/1762-12: 0.25 inch X 12 inch (6.35 mm X 305 mm)<br>1760/1762-20: 0.25inch X 20 inch (6.35 mm X 500 mm)  |
| <b>External Leads</b>             | Teflon™ –insulated copper wire, 4 leads, 2.5 meters  |
| <b>Handle Dimension</b>           | 15mm (OD) X 65 mm (L)  |
| <b>Handle Temperature Range**</b> | -50°C to 180°C   |
| <b>Calibration Options</b>        | 1760/1762-12-T, Secondary SPRT with NIST traceable calibration and data<br>1760/1762-20-T, Secondary SPRT with NIST traceable calibration and data |

### **3 General Operations**

#### **3.1 Connecting to the readout device**

The AM1760/1762 is equipped with a four-wire cable (see Figure 1). Four lead wires are used to cancel lead wire resistance. For best results, the readout device should be equipped to handle four-terminal resistors. The lead wires can be distinguished by insulation colors. Lead wire pairs attached to each end of the sensor are identified by red/black and white/blue insulation.



**Figure1**

#### **3.2 Drive Current**

AccuMac recommends 1mA as drive current to ensure the best measurement.

#### **3.3 Stability of Readings**

To achieve the best accuracy, allow sufficient time for SPRT to stabilize before taking the readings.

#### **3.4 Immersion Requirements**

Stem effect can cause measurement errors due to heat lost or gained by the sensing element through the thermometer stem. To minimize the error, appropriate immersion depths are required. A practical way to determine the minimum immersion depths is to

change the depth gradually until the readings have significant changes after stabilization.

Do not submerge SPRT handle when taking measurement.

### **3.5 Thermal EMF**

Each AccuMac PRT has gone through an annealing process and stability test to minimize the thermal EMF, which is caused by either impurities of sensing element or temperature differentials at lead wires connection point.

### **3.6 Over Heating**

The sensing element of AM1760/1762 SPRT is sealed inside an Inconel™ sheath to ensure the best stability and repeatability. The seal can be breached if the SPRT is over heated for an extended period of time.



## **4 Care and Handling Guidelines**

1. DO NOT subject the PRT to any physical shocks and vibrations.
  - a. When not using the PRT, keep it in a place that's not prone to drop, slam, bang, vibration or other strong physical contacts. Use a protective box or a carrying case whenever possible.
  - b. When shipping the PRT, use protective box and other protective packaging materials to minimize mechanical shocks as much as possible.
  - c. When using dry blocks, make sure the well diameter is appropriate to allow the PRT move up and down smoothly.
2. DO NOT subject the PRT to any contaminations.
  - a. Keep the PRT as clean as possible. Avoid contaminations as much as possible.
3. DO NOT over heat.
  - a. Do not use PRT above the manufacture specified temperature range.
  - b. Do not expose the PRT handle and lead wires to extreme temperatures.

## **5 Troubleshooting**

### **5.1 Troubleshooting**

If the PRT functions abnormally, it could be caused by several possible problem conditions that are described in this section. Try the solutions recommended and if the problems are still not solved, contact manufacture for warranty or repair service. Be sure to have the model number and serial number of your PRT available.

### **5.2 Problem Causes and Solutions**

- a. R0/Rtpw becomes higher significantly. This is likely caused by mechanical shocks. The PRT should be annealed to release the stress of platinum wires and to recover R0/Rtpw value. Measure R0/Rtpw of the PRT after annealing to verify.
- b. R0/Rtpw unstable during the measurement. This is likely caused either by bad connections or sensor coils short. Check the connections first and if the connections are good, the PRT may be damaged.

## **6 Limited Warranty & Limitation of Liability**

The material contained in this document is provided “as is,” and is subject to being changed, without notice, in future editions.

AccuMac shall not be liable for errors or for incidental or consequential damages in connection with the furnishing, use, or performance of this document or of any information contained herein. Should AccuMac and the user have a separate written agreement with warranty terms covering the material in this document that conflict with these terms, the warranty terms in the separate agreement shall control.

Each product from AccuMac Corporation is warranted to be free from defects in material and workmanship under normal use and service. The warranty period is 1 year for the Platinum Resistance Thermometer. The warranty period begins on the date of the shipment. Parts, product repairs, and services are warranted for 90 days. The warranty extends only to the original buyer or end-user customer of an AccuMac authorized reseller. The warranty will not be extended to products that have been misused, altered, neglected, or damaged by accident or abnormal conditions of operation or handling.

To obtain warranty service, contact AccuMac Corporation at:

3150 N Arizona Ave STE 103

Chandler, AZ 85225

USA

Tel: (480) 634-0603

Email: [sales@accumac.com](mailto:sales@accumac.com)